NISTIR 7183

Vibration Signatures for Three Positive Displacement Compressors

David A. Yashar W. Vance Payne

U.S. DEPARTMENT OF COMMERCE National Institute of Standards and Technology Building Environment Division Building and Fire Research Laboratory Gaithersburg, Maryland 20899-8631



National Institute of Standards and Technology Technology Administration United States Department of Commerce

NISTIR 7183

Vibration Signatures for Three Positive Displacement Compressors

David A. Yashar W. Vance Payne

U.S. DEPARTMENT OF COMMERCE National Institute of Standards and Technology Building Environment Division Building and Fire Research Laboratory Gaithersburg, Maryland 20899-8631

December 2004



U.S. Department of Commerce Donald L. Evans, Secretary

National Institute of Standards and Technology Arden L. Bement, Jr., Director

Vibration Signatures for Three Positive Displacement Compressors

David A. Yashar and W. Vance Payne

Abstract

This report presents vibration data for three positive displacement compressors which will be used to evaluate Microelectromechanical Systems (MEMS) vibration sensors at a later time. The axial, radial and tangential vibration signatures of three compressors were measured under different operating conditions. An open-drive four cylinder compressor's vibration signatures were measured at discharge pressures of 1724 kPa (250 psig) and 2413 kPa (350 psig), with three different drive frequencies. A hermetic scroll compressor's vibration signatures were measured at three drive frequencies with a discharge pressure of 1724 kPa (250 psig), and at one drive frequency with a discharge pressure of 2241 kPa (325 psig). Finally a large, six-cylinder, chiller compressor's vibration signatures were measured with two, four, and six of the cylinders engaged.

Keywords: compressor vibration

TABLE OF CONTENTS

Abstract		ii
List of Ta	ables	iii
List of Fi	igures	iv
Nomencl	ature	vi
Acknowl	edgment	vii
1:	Introduction	1
2:	Experimental Setup	2 3 3
3:	Experimental Procedure	5 5
4:	Experimental Results 4.1: Four cylinder, reciprocating compressor vibration signatures 4.2: Hermetic, scroll compressor vibration signatures 4.3: Six cylinder, reciprocating compressor vibration signatures	7 10
5:	Concluding Remarks	18
Referenc	es	19
Appendix	x A: Vibration Analysis Derivations	20

List of Tables

2.1.1:	Data acquisition card and accelerometer specifications	2
3.1.1:	Four cylinder, reciprocating compressor test conditions	5
3.2.1:	Hermetic, scroll compressor test conditions	6
3.3.1:	Six cylinder, reciprocating compressor test conditions	6

List of Figures

2.1.1:	Triaxial accelerometer	3
2.2.1:	Four cylinder, open-drive, reciprocating compressor	3
2.3.1:	Hermetic, scroll compressor	4
2.4.1:	Six cylinder, reciprocating compressor	4
4.1.1:	Axial acceleration for four-cylinder reciprocating compressor at three frequencies at the low discharge pressure	7
4.1.2:	Radial acceleration for four-cylinder reciprocating compressor at three frequencies at the low discharge pressure	7
4.1.3:	Tangential acceleration for four-cylinder reciprocating compressor at three frequencies at the low discharge pressure	8
4.1.4:	Axial, radial, and tangential acceleration for four-cylinder reciprocating compressor at 45 Hz	9
4.1.5:	Tangential acceleration for four-cylinder reciprocating compressor at three frequencies at the high discharge pressure	9
4.1.6:	Tangential acceleration for four-cylinder reciprocating compressor at 45 Hz at the low and high discharge pressure	10
4.2.1:	Axial acceleration for the scroll compressor at three frequencies at the low discharge pressure	11
4.2.2:	Radial acceleration for the scroll compressor at three frequencies at the low discharge pressure	11
4.2.3:	Tangential acceleration for the scroll compressor at three frequencies at the low discharge pressure	12
4.2.4:	Axial, radial, tangential acceleration for the scroll compressor at 30 Hz at the low discharge pressure	12
4.2.5:	Axial and radial acceleration for the scroll compressor at 25 Hz at the high discharge pressure	13
4.2.6:	Radial acceleration for the scroll compressor at 25 Hz at the low and high discharge pressure	13

4.2.7:	Axial acceleration for the scroll compressor failure at a drive frequency of 25 Hz and low pressure	14
4.3.1:	Axial, radial, and tangential acceleration with two-cylinders loaded for the large reciprocating compressor	15
4.3.2:	Axial, radial, and tangential acceleration with four-cylinders loaded for the large reciprocating compressor	15
4.3.3:	Axial, radial, and tangential acceleration with six-cylinders loaded for the large reciprocating compressor	16
4.3.4:	Axial acceleration with two-, four-, and six-cylinders loaded for the large reciprocating compressor	16
4.3.5:	Radial acceleration with two-, four-, and six-cylinders loaded for the large reciprocating compressor	17
4.3.6:	Tangential acceleration with two-, four-, and six-cylinders loaded for the large reciprocating compressor	17
A1: Sl	ketch of a bearing	20

Nomenclature

f_o f/f_o rotational frequency of the compressor shaft (r/s or Hz)

ratio of vibration frequency to the compressor shaft rotational frequency

acceleration experienced by a unit of mass within earth's gravity field, equivalent g_n

to 9.81 m/s 2 (32.2 ft/s 2)

outside diameter, mm (in) OD

compressor shaft revolutions per minute **RPM**

VDC volts of direct current

Acknowledgment

The authors thank Mr. John Wamsley, Mr. Glenn Savage, and Mr. Glen Glaeser for their assistance with the testing of these compressors.

1: Introduction

Vibration signatures of machinery contain a wealth of information regarding the interaction of all of the machine's components. For this reason, it is practicable to use vibration monitoring to detect and diagnose compressor faults before they lead to catastrophic failure. In order to successfully implement vibration as a means of fault detection, it is necessary to acquire and evaluate the appropriate measurement equipment.

Changes in the vibration signature over time may indicate that a defect has become present somewhere in the system. Therefore, it is possible to detect a fault by comparing the vibration signature of a faultless system to the signature of the same system after a period of operation. By continuously monitoring the vibration signature, it is possible to detect a fault before it becomes severe to the point of mechanical failure. Furthermore, Johnson (2000) reasoned that if a particular mode of failure were expected, one could expect to see enhanced excitation of specific frequencies while monitoring the vibration signature of a system (see Appendix A for detailed derivations regarding roller bearing failure). Therefore, it is not only possible to detect the presence of a problem, but also to diagnose problems as they arise.

Commercially available accelerometers provide an excellent means for acquiring vibration information; however the cost associated with these sensors makes them unattractive for heating, ventilation, air conditioning and refrigeration (HVAC&R) applications. MEMS accelerometers offer a viable, low cost option for data acquisition, but they must first be evaluated for this application. In order to evaluate their feasibility, a series of vibration signatures for several compressors must be catalogued for a reference in evaluating the response of a vibration meter to known conditions.

2: Experimental Setup

2.1: Data acquisition equipment and uncertainty

The vibrational signatures of each compressor were gathered using a triaxial quartz accelerometer and dynamic signal acquisition card located in the personal computer interface (PCI) bus of a personal computer. Table 2.1.1 lists the characteristics of the accelerometer and data acquisition card. Figure 2.1.1 shows the size of the triaxial accelerometer relative to a writing pen. The manufacturer of the accelerometer lists its 95 % confidence limit (two sigma on the measured value) for acceleration to be ± 5 % of the reading. In the table below, bias level is the voltage offset above 0 VDC; therefore, all acceleration waveforms will originate (or be centered around) the bias level voltage. The bias level voltage may be subtracted from the acceleration waveform to produce the raw acceleration waveform with zero bias.

Table 2.1.1: Data acquisition card and accelerometer specifications

Tuore 2.1.1. Buttu declarate	Table 2.1.1. Data acquisition card and accelerometer specifications			
Three-Axis Accelerometer with $a \pm 490 \text{ m/s}^2 (50 \text{ g}_n)$ range				
Model 356B07				
x-axis, sensitivity	$9.82 \text{ mV/(m/s}^2) [96.3 \text{ mV/g}_n]$			
x-axis, bias level	11.6 VDC			
y-axis, sensitivity	$10.04 \text{ mV/(m/s}^2) [98.5 \text{ mV/g}_n]$			
y-axis, bias level 11.5 VDC				
z-axis, sensitivity	$9.69 \text{ mV/(m/s}^2) [95.0 \text{ mV/g}_n]$			
z-axis, bias level	axis, bias level 11.3 VDC			
PCI Dynamic Signal Acquisition Card				
Sample Rate	5 to 205 thousands of samples per second			
Inputs	Inputs 2 analog, 16 bit			
Bandwidth	Bandwidth 0 kHz to 95 kHz			
Dynamic Range	Dynamic Range 90 dB			

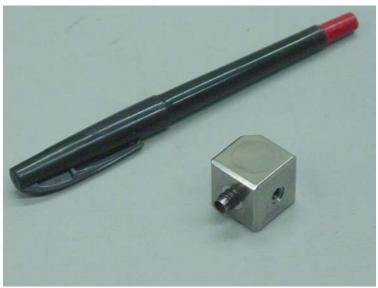


Figure 2.1.1: Triaxial accelerometer

Data acquisition code was written using commercial DAQ software. The vibrational waveforms were captured and analyzed using a Fast Fourier Transform (FFT) to clarify those frequencies experiencing the high amplitude vibration.

2.2: Four cylinder, reciprocating compressor

The open-drive R22 compressor shown in Figure 2.2.1 was connected to a 5.6 kW (7.5 hp) motor with full speed of 184.3 rad/s (1760 RPM) at 60 Hz. This compressor uses bronze bushed bearings. The picture on the right-hand side of Figure 2.2.1 uses arrows to indicate where the mounting fixtures for the accelerometer were located. Radial, axial, and tangential vibration measurements were taken for this compressor.





Figure 2.2.1: Four cylinder, open-drive, reciprocating compressor (the arrows on picture at the right indicate the position of vibration sensor mounts)

2.3: Hermetic, scroll compressor

The R410A scroll compressor shown in Figure 2.3.1 had a displacement of 10.13 m³/h (5.96 ft³/min) at 366.5 rad/s (3500 RPM) operating at 230 V, 3-phase. Figure 2.3.1 uses arrows

to indicate where the mounting fixtures for the accelerometer were located. Radial, axial, and tangential vibration measurements were taken for this compressor.



Figure 2.3.1: Hermetic, scroll compressor (the arrows on the picture indicate the position of the vibration sensor mounts)

2.4: Six cylinder, reciprocating compressor

The large, open-drive R404A compressor shown in Figure 2.4.1 has a displacement of 796 m³/h (7.54 ft³/s). The compressor can be operated with two, four, or six cylinders with various amount of hot-gas bypass for capacity control. The unit operates at constant shaft rotational speed. Motor shaft speed is 186.9 rad/s (1785 RPM) on a 26.0 cm OD (10.25 in OD) sheave connected to the driven sheave with an OD of 67.3 cm (26.5 in). This produces a compressor shaft rotational speed of approximately 72.3 rad/s (690 RPM). The compressor uses automotive style journal bearings fed by pressurized oil on its crankshaft. Figure 2.4.1 uses arrows to indicate where the mounting fixtures for the accelerometer were located. Radial, axial, and tangential vibration measurements were taken for this compressor.



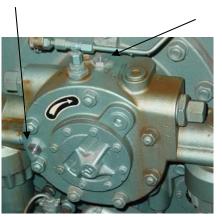


Figure 2.4.1: Six cylinder, reciprocating compressor (the arrows on the picture at the right indicate the position of the vibration sensor mounts)

3: Experimental Procedure

A triaxial accelerometer was mounted on each compressor in two locations; 1) close to the main axis of the compressor crank shaft for axial and radial acceleration measurements, and 2) tangential to the crank-axis for tangential acceleration measurements. Several scans were made at a rate of 100 000 scans per second for 1 s in the axial, radial, and tangential directions. Data were recorded as voltages with respect to sample time, and the data were also processed using FFT to reveal frequency characteristics of the vibration signals.

To further aid in simplifying the data, the vibration frequencies were tabulated as multiples of the rotational frequency (r/s, f_0). Estimates of the rotational frequency for the four cylinder reciprocating compressor and the hermetic scroll compressor were based upon the drive frequency and the motor speed at 60 Hz. A simple linear relationship was assumed to give an estimate of the rotational frequency, i.e., Drive frequency / 60 Hz x Motor Rotational Velocity at 60 Hz. The estimated rotational frequency of the six cylinder reciprocating compressor was 72.3 rad/s (690 RPM).

In all cases, the peaks of the various harmonics were typically within 2 % of the estimated rotational frequency, with the most extreme difference being less than 9 %. The exact rotational frequency was found by adjusting the frequency so that the harmonics aligned with integer multiples of the rotational frequency.

3.1: Four cylinder, reciprocating compressor test procedure

(1026 RPM)

138.2 rad/s

(1320 RPM)

The compressor was tested with two discharge pressures and three different drive frequencies. Table 3.1.1 lists the pressures, drive frequencies, and resulting shaft rotational frequency for each test

Estimated Shaft True Shaft Rotational Speed **Drive Frequency** Rotational Speed 1724 kPa (250 psig) discharge 2413 kPa (350 psig) discharge 25 Hz 76.8 rad/s 72.3 rad/s 70.7 rad/s (733 RPM) (690 RPM) (675 RPM) 35 Hz 107.4 rad/s 104.7 rad/s 103.7 rad/s

(1000 RPM)

136.7 rad/s

(1305 RPM)

(990 RPM)

136.1 rad/s

(1300 RPM)

Table 3.1.1: Four cylinder, reciprocating compressor test conditions

3.2: Hermetic, scroll compressor test procedure

45 Hz

The scroll compressor had been part of an R410A variable speed condensing unit. Before the vibration tests, the scroll was operated between 40 Hz and 65 Hz during the system testing and at various operating conditions with the added protection of an oil separator on the compressor discharge. The compressor performed with almost no audible noise or vibration for several weeks while operating in the normal frequency range. The operator then began to notice the amperage draw of the compressor had increased over a several day period. This change in amperage caused him to observe the compressor more closely. During a normal test where the

condensing unit compressor was operating at 45 Hz, a loud rattle was heard and the compressor over-amped, tripping the amperage limit on the variable speed drive. Subsequent attempts to operate the compressor above a 40 Hz drive frequency resulted in the same loud rattle and shutdown after less than 3 min of operation.

In order to obtain some useful vibration data from this compressor, the compressor drive frequency was lowered until the compressor would operate for 10 min to 15 min without rattle or over-amping. Vibration data were recorded at two pressures and several drive frequencies below the rattling frequency. At higher pressures the compressor exhibited excessive noise and vibration due to an unknown failure of its internal components. The loud knock and excessive vibration data were also recorded and presented in this report. Table 3.2.1 shows the test matrix for this compressor. Tests at higher frequencies were not possible due to excessive vibrations and motor over-amping (high current draw).

Table 3.2.1: Hermetic, scroll compressor test conditions

Drive Frequency	Estimated Shaft Rotational Speed	True Shaft Rotational Speed	
		1724 kPa (250 psig) discharge	2413 kPa (350 psig) discharge
20 Hz	122.2 rad/s	119.4 rad/s	
	(1167 RPM)	(1140 RPM)	
25 Hz	152.7 rad/s	150.8 rad/s	141.4 rad/s
	(1458 RPM)	(1440 RPM)	(1350 RPM)
30 Hz	183.3 rad/s	183.3 rad/s	
	(1750 RPM)	(1750 RPM)	

3.3: Six cylinder, reciprocating compressor test procedure

The large, open-drive reciprocating compressor was tested with different numbers of cylinder engaged. Pressure control and drive frequency control were not possible with this compressor. Table 3.3.1 lists the test matrix for this compressor.

Table 3.3.1: Six cylinder, reciprocating compressor test conditions

	True Shaft Rotational Speed		
Estimated Drive RPM	2 cylinders (with hot gas bypass)	4 cylinders	6 cylinders
72.3 rad/s	71.9 rad/s	71.6 rad/s	71.0 rad/s
(690 RPM)	(687 RPM)	(684 RPM)	(678 RPM)

4: Experimental Results

The following figures characterize the vibrational signatures of the three compressors operating under various load conditions.

4.1: Four cylinder, reciprocating compressor vibration signatures

This compressor was operated at two different discharge pressures and three drive frequencies. Figures 4.1.1, 4.1.2, and 4.1.3 show the axial, radial, and tangential components, respectively, of acceleration at multiples of the rotational speed for 1724 kPa (250 psig) discharge pressure and three different drive speeds. Figure 4.1.4 shows the axial, radial, and tangential vibration signatures at a 1724 kPa (250 psig) discharge pressure with a drive frequency of 45 Hz. Figure 4.1.5 shows the tangential acceleration for 2413 kPa (350 psig) discharge pressure at drive frequencies of 25 Hz, 35 Hz, and 45 Hz. Figure 4.1.6 shows the tangential acceleration at a drive frequency of 45 Hz for both discharge pressures.

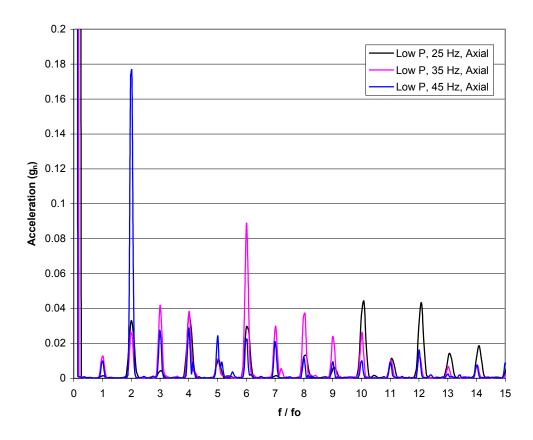


Figure 4.1.1: Axial acceleration for four-cylinder reciprocating compressor at three frequencies at the low discharge pressure

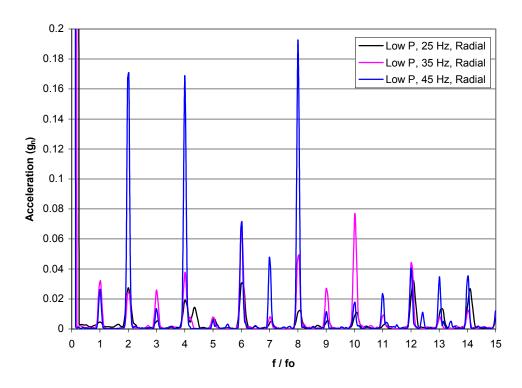


Figure 4.1.2: Radial acceleration for four-cylinder reciprocating compressor at three frequencies at the low discharge pressure

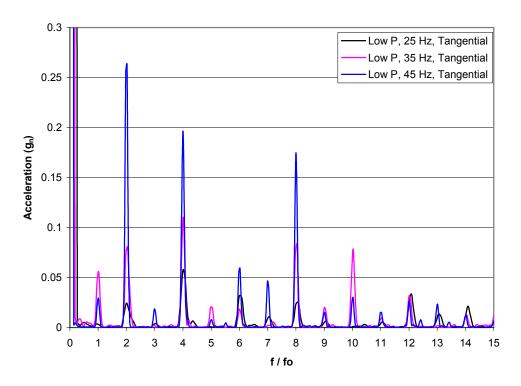


Figure 4.1.3: Tangential acceleration for four-cylinder reciprocating compressor at three frequencies at the low discharge pressure

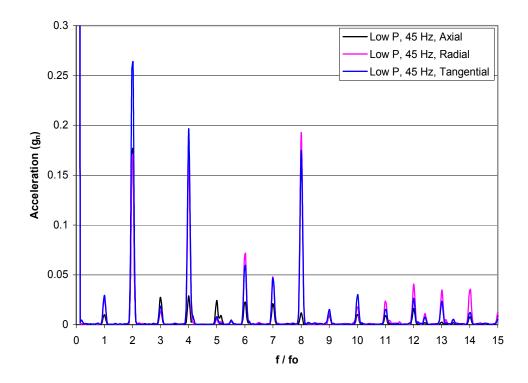


Figure 4.1.4: Axial, radial, and tangential acceleration for four-cylinder reciprocating compressor at 45 Hz

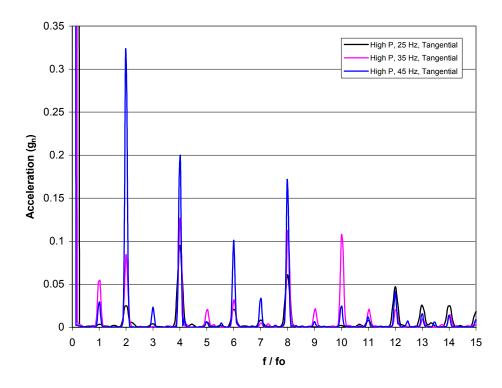


Figure 4.1.5: Tangential acceleration for four-cylinder reciprocating compressor at three frequencies at the high discharge pressure

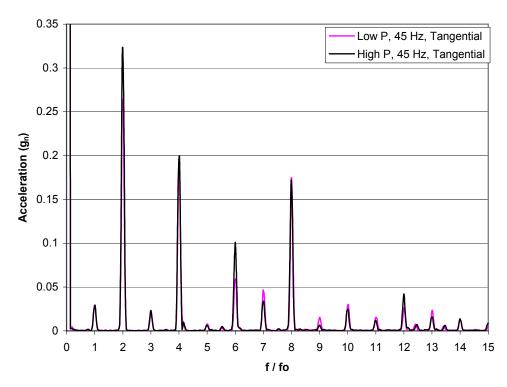


Figure 4.1.6: Tangential acceleration for four-cylinder reciprocating compressor at 45 Hz at the low and high discharge pressure

4.2: Hermetic, scroll compressor vibration signatures

The scroll compressor was tested at 20 Hz, 25 Hz, and 30 Hz with a discharge pressure of 1724 kPa (250 psig). The compressor was tested at 25 Hz and 2241 kPa (325 psig) as well, but only axial and radial acceleration were measured. Only one frequency was tested at the higher pressure due to excessive noise and over-amping of the variable speed drive. The figures below show the vibration amplitude with frequencies shown as multiples of the rotational frequency.

Figures 4.2.1, 4.2.2, and 4.2.3 show the axial, radial, and tangential components, respectively, of acceleration at multiples of the rotational speed for 1724 kPa (250 psig) discharge pressure and three different drive speeds. Figure 4.2.4 shows the axial, radial, and tangential vibration signatures at a 1724 kPa (250 psig) discharge pressure with a drive frequency of 30 Hz. Figure 4.2.5 shows the axial and radial acceleration for 2241 kPa (325 psig) discharge pressure at a drive frequency of 25 Hz. Figure 4.2.6 shows the radial acceleration at a drive frequency of 25 Hz for both discharge pressures.

Figure 4.2.7 shows the vibrations experienced by the scroll compressor during a failure. The system was immediately shut down by the technician when these vibrations occurred. The figure shows that acceleration in the axial direction approached 3 g_n's at a frequency ratio between 0.03 and 0.05. This corresponds to approximately 8 Hz to 10 Hz in the frequency domain. This level of vibration is two to three orders of magnitude larger than vibrations seen during normal operation.

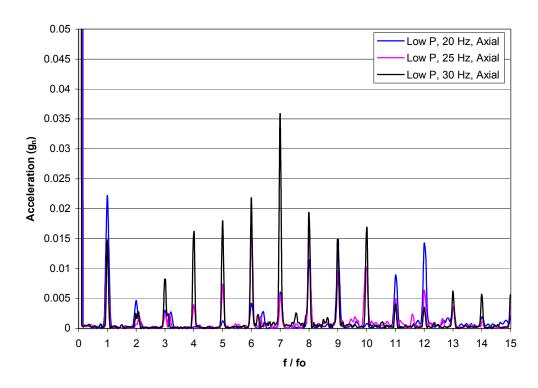


Figure 4.2.1: Axial acceleration for the scroll compressor at three frequencies at the low discharge pressure

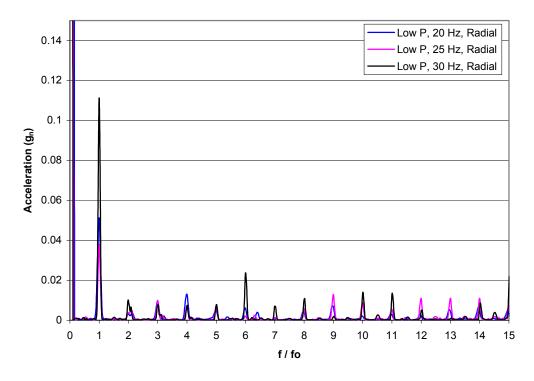


Figure 4.2.2: Radial acceleration for the scroll compressor at three frequencies at the low discharge pressure

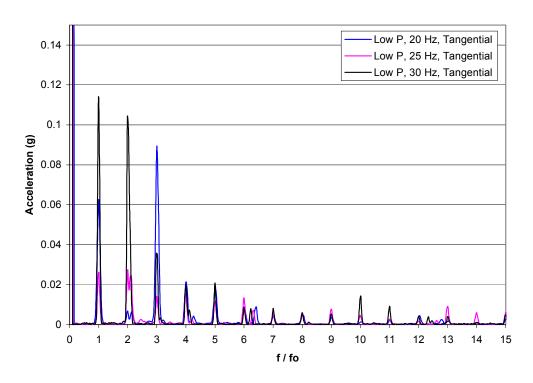


Figure 4.2.3: Tangential acceleration for the scroll compressor at three frequencies at the low discharge pressure

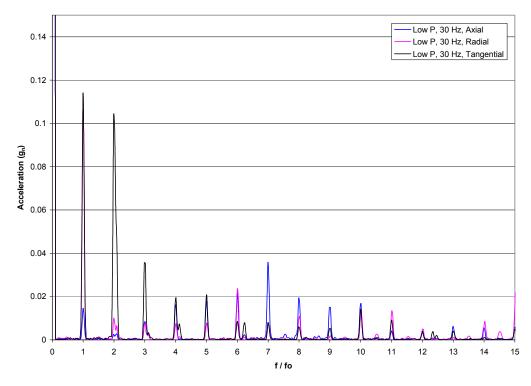


Figure 4.2.4: Axial, radial, tangential acceleration for the scroll compressor at 30 Hz at the low discharge pressure

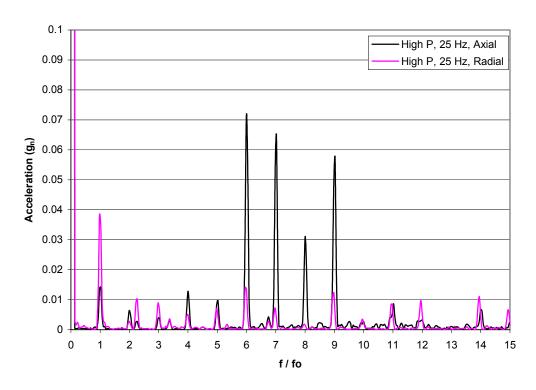


Figure 4.2.5: Axial and radial acceleration for the scroll compressor at 25 Hz at the high discharge pressure

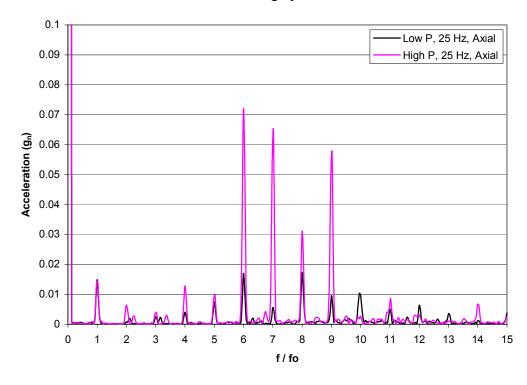


Figure 4.2.6: Radial acceleration for the scroll compressor at 25 Hz at the low and high discharge pressure

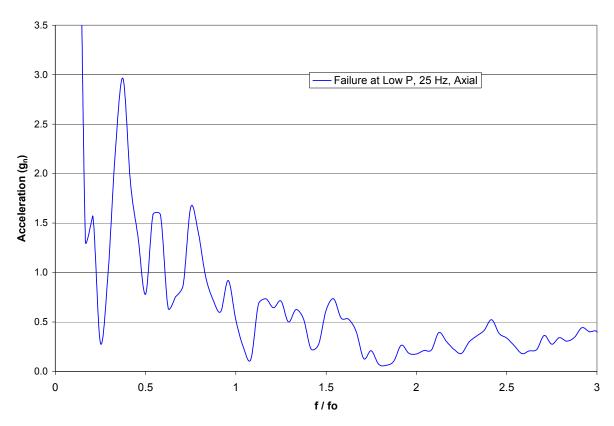


Figure 4.2.7: Axial acceleration for the scroll compressor failure at a drive frequency of 25 Hz and low pressure

4.3: Six cylinder, reciprocating compressor vibration signatures

The six cylinder reciprocating compressor was tested at three different levels of loading; operation with two, four, or six cylinders engaged. The figures below show the vibration amplitude with frequencies shown as multiples of the rotational frequency.

Figures 4.3.1, 4.3.2, and 4.3.3 show all three components of acceleration at multiples of the rotational speed for two-cylinder, four-cylinder, and six-cylinder operation, respectively. Figures 4.3.4, 4.3.5, and 4.3.5 show the axial, radial, and tangential components, respectively, of acceleration at multiples of the rotational speed for the three different loading levels. It is interesting to note that a $\frac{1}{2}$ f_0 component of acceleration was seen for each measurement, although this does not align with the shaft rotational frequency. This component is seen between the second and third harmonic, as well as multiples of $\frac{1}{2}$ f_0 . Its magnitude was the smallest when the compressor was fully loaded and running on six cylinders. This $\frac{1}{2}$ f_0 component of vibration had the largest magnitude in the axial direction (parallel with the compressor crank shaft). No obvious reason for this vibration was noted, and it may be a normal phenomenon that was part of the compressor's no-fault vibration signature.

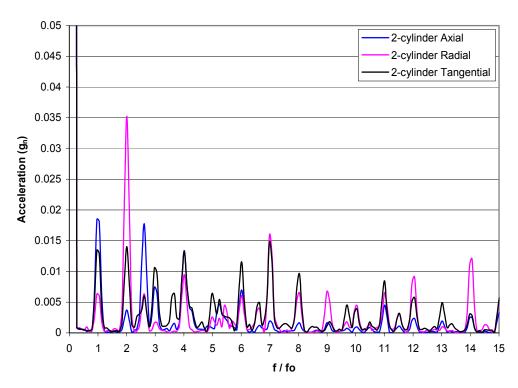


Figure 4.3.1: Axial, radial, and tangential acceleration with two cylinders loaded for the large reciprocating compressor

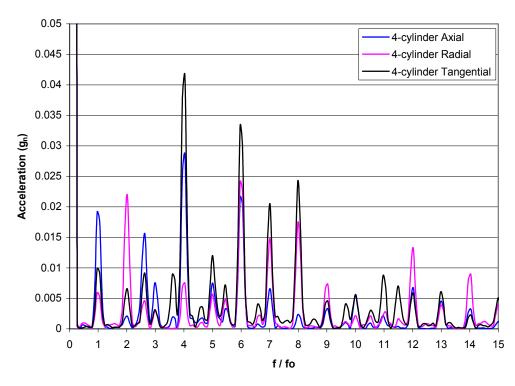


Figure 4.3.2: Axial, radial, and tangential acceleration with four cylinders loaded for the large reciprocating compressor

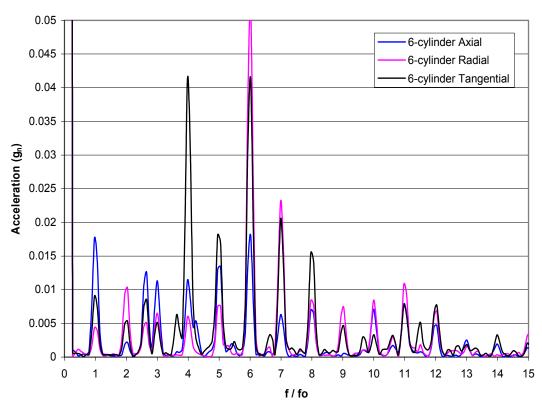


Figure 4.3.3: Axial, radial, and tangential acceleration with six cylinders loaded for the large reciprocating compressor

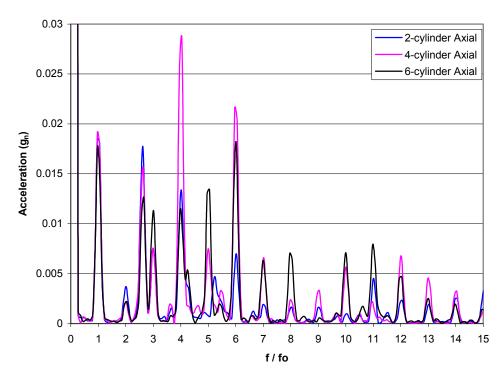


Figure 4.3.4: Axial acceleration with two, four, and six cylinders loaded for the large reciprocating compressor

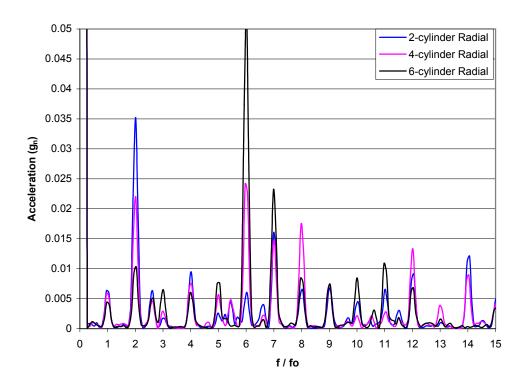


Figure 4.3.5: Radial acceleration with two, four, and six cylinders loaded for the large reciprocating compressor

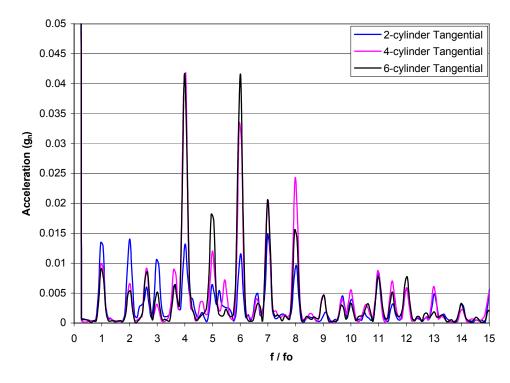


Figure 4.3.6: Tangential acceleration with two, four, and six cylinders loaded for the large reciprocating compressor

5: Concluding Remarks

The preceding figures document the vibration characteristics of three different compressors. These vibration signatures are useful in evaluating a vibration meter that may be applied to future test systems; any vibration meter should have sampling and response characteristics sufficient to capture the vibrations seen with these compressors. The vibration signatures presented here are not meant to detect a fault within the compressor, but serve only to indicate the range of vibrations seen during normal operation of these compressors. Long term monitoring, trending, and fault simulations would need to be performed in order to diagnose a particular fault using vibration information. This document is intended to serve as a catalog for steady-state vibration information and help evaluation of future vibration measurement devices.

The vibration tests included a scroll compressor that had a failure during testing. This failure allowed characterization of the vibration amplitude and frequency that would be seen in an actual field-installed system. The vibration meter meant to detect this failure should have a resolution of at least ± 9.8 m/s² (± 1 g_n). Normal operations of all the compressors tested here were below 4.9 m/s² (0.5 g_n) in all directions. Vibration meters with greater sensitivity may cost more to produce and may be less robust in a compressor system environment. At a minimum, all of these factors must be weighed against development and economic constraints when designing a workable vibration meter.

References

Johnson, Michael S. "Vibration Tests for Bearing Wear," ASHRAE Journal, October 2000, pp. 52-58.


Appendix A: Vibration Analysis Derivations for Rolling Element Bearings

Figure A.1 shows a schematic of a rolling element bearing. The inner race has a radius R, the roller has a radius r, and the shaft is rotating clockwise at a rate ω_s . The position of the roller relative to the center of the shaft is defined by the angle ϕ . There are n rollers distributed throughout the bearing.

Because the top of the roller is in contact with the fixed outer race, and the bottom of the roller is in contact with the inner race at point A, the velocity of point A is defined by:

$$V_A = 2r \times \dot{\theta}$$

 θ defines the angle of rotation of the roller.

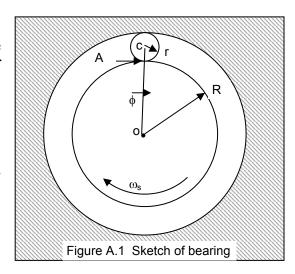

The velocity of this point is also defined by its position relative to the center of the shaft:

$$V_A = -R \times \omega_{\rm s}$$

Therefore, the angular rate of rotation of the roller is related to the shaft rotation rate:

$$\stackrel{\bullet}{\theta} = -\frac{R}{2r}\omega_s$$

The velocity of the center of the roller is defined by its path around the center of the shaft:

$$V_c = -(R+r) \times \phi$$

But since the top of the roller is the instantaneous center of rotation, the velocity of point C is also defined by:

$$V_c = r \times \dot{\theta}$$

Therefore the rate at which the roller orbits the center of the shaft is related to the rotation rate of the roller:

$$\dot{\phi} = -\frac{r}{(R+r)} \times \dot{\theta}$$

And therefore, it is related to the shaft rotation rate:

$$\dot{\phi} = \left(-\frac{r}{(R+r)}\right) \times \left(-\frac{R}{2r}\omega_s\right) = \frac{R}{2(R+r)}\omega_s$$

This is the rate at which a fixed point on the outer race of the bearing will be in contact with a roller. If a defect were present on the surface of the outer race, it would be impacted by the

20

roller at this rate. Since there are n rollers evenly spaced along this bearing, the rate at which rollers come into contact with this defect is related to the shaft rotation rate:

$$\omega_{outer,contact} = \frac{nR}{2(R+r)}\omega_s$$

The rate of contact between an inner race surface defect and a roller is found as follows. The angle of rotation of the shaft, α (ω_s is the time derivative of α), is related to the orbital rate of the roller. From the previous step:

$$\frac{d\phi}{dt} = \frac{R}{2(R+r)} \frac{d\alpha}{dt}$$

The roller will be in contact with the same point on the inner race every time the inner race laps the roller:

$$\phi = \alpha - 2k\pi$$

Therefore:

$$\phi = \alpha - 2k\pi = \frac{R}{2(R+r)}\alpha$$

$$2k\pi = \left(1 - \frac{R}{2(R+r)}\right)\alpha = \frac{(R+2r)}{2(R+r)}\alpha$$

Since there are n rollers, the rate at which rollers come into contact with a point on the inner race is:

$$\omega_{inner,contact} = \frac{n(R+2r)}{2(R+r)}\omega_s$$

Finally, in order to find the impact rate for a defect on the surface of a roller itself, one must visualize the roller completing one full orbit:

$$\phi = 2\pi$$

During this orbit, the prior relationship shows that the roller will rotate through an angle of:

$$\theta = \frac{2\pi}{r} (R + r)$$

In other words, the roller will go through $\frac{(R+r)}{r}$ rotations as it completes one orbit.

Since one contact with each race is added through each orbit because of the changing angle of

contact, a point on the surface of the roller will be in contact $\frac{(R+2r)}{r}$ times with each race.

Since there are an inner and an outer race, this point will be impacted a total

of
$$\frac{2(R+2r)}{r}$$
 times throughout each orbit.

Since the orbital rate is related to the shaft rotation rate:

$$\dot{\phi} = \frac{R}{2(R+r)}\omega_s$$

A point on the surface of a roller will be in contact with the races at the rate of:

$$\omega_{roller,impact} = \frac{R(R+2r)}{r(R+r)}\omega_{s}$$